



P.O. Box 26329, Fayetteville, NC 28314
Web: www.lavacable.com

Phone: (910) 797-7214 Fax: (910) 864-1296
Email: mark@lavacable.com

Lava Solder-Free Kit Tips:

1. Strip about ½” and cut excess with sharp scissors (the small sharp ones can be bought in the sewing section of Wal Mart), xacto knife, razor blade or cutters
2. Smooth braid with thumb and index finger
3. You can use a little Finger Ease (string lubricant) if having trouble pushing shield on
4. Push sleeve on slowly – being careful not to bunch shield up
5. Once sleeve is touching base of outer jacket give it a hard push over the jacket so it is good and snug
6. Make sure braid is bent over beveled edge of sleeve only and visually inspect so there’s not portion of the braid coming in contact with center conductor – too much braid will make putting plug on difficult snip excess with cutters
7. Should have a about 1/16” to 1/32” of cable protruding from end of sleeve
8. Prior to twisting housing on you can pull plug out to make sure needle made contact with conductor – if not move conductor with fingers until it does
9. You can use a little dab of low grade thread locker on housing to keep it in place better – use low grade ONLY as you can still twist off if needed